SIEMENS

Data sheet 3RV2011-0BA10



Circuit breaker size S00 for motor protection, CLASS 10 A-release 0.14...0.2 A N-release 2.6 A screw terminal Standard switching capacity

product brand name	SIRIUS
product designation	Circuit breaker
design of the product	For motor protection
product type designation	3RV2
General technical data	
size of the circuit-breaker	S00
size of contactor can be combined company-specific	S00, S0
product extension auxiliary switch	Yes
power loss [W] for rated value of the current	
 at AC in hot operating state 	5.5 W
 at AC in hot operating state per pole 	1.8 W
insulation voltage with degree of pollution 3 at AC rated value	690 V
surge voltage resistance rated value	6 kV
shock resistance according to IEC 60068-2-27	25g / 11 ms
mechanical service life (operating cycles)	
 of the main contacts typical 	100 000
of auxiliary contacts typical	100 000
electrical endurance (operating cycles) typical	100 000
type of protection according to ATEX directive 2014/34/EU	Ex II (2) GD
certificate of suitability according to ATEX directive 2014/34/EU	DMT 02 ATEX F 001
reference code according to IEC 81346-2	Q
Substance Prohibitance (Date)	10/01/2009
Ambient conditions	
installation altitude at height above sea level maximum	2 000 m
ambient temperature	
 during operation 	-20 +60 °C
during storage	-50 +80 °C
during transport	-50 +80 °C
relative humidity during operation	10 95 %
Main circuit	
number of poles for main current circuit	3
adjustable current response value current of the current- dependent overload release	0.14 0.2 A
operating voltage	
rated value	20 690 V
 at AC-3 rated value maximum 	690 V
at AC-3e rated value maximum	690 V
operating frequency rated value	50 60 Hz
operational current rated value	0.2 A
operational current	

• at AC-3 at 400 V rated value	0.2 A
at AC-3e at 400 V rated value	0.2 A
operating power	
• at AC-3	
— at 230 V rated value	0 kW
— at 400 V rated value	0.06 kW
— at 500 V rated value	0.1 kW
— at 690 V rated value	0.1 kW
• at AC-3e	C. F. KAT
— at 230 V rated value	0 kW
— at 400 V rated value	0.06 kW
— at 500 V rated value	0.1 kW
— at 690 V rated value	0.1 kW
operating frequency	U. I KVV
at AC-3 maximum	15 1/h
at AC-3e maximum	15 1/h
Auxiliary circuit	
number of NC contacts for auxiliary contacts	0
number of NO contacts for auxiliary contacts	0
number of CO contacts for auxiliary contacts	0
Protective and monitoring functions	
product function	
ground fault detection	No
phase failure detection	Yes
trip class	CLASS 10
design of the overload release	thermal
maximum short-circuit current breaking capacity (Icu)	
 at AC at 240 V rated value 	100 kA
 at AC at 400 V rated value 	100 kA
 at AC at 500 V rated value 	100 kA
 at AC at 690 V rated value 	100 kA
operating short-circuit current breaking capacity (Ics) at AC	
at 240 V rated value	100 kA
at 400 V rated value	100 kA
at 500 V rated value	100 kA
• at 690 V rated value	100 kA
response value current of instantaneous short-circuit trip unit	2.6 A
UL/CSA ratings	
full-load current (FLA) for 3-phase AC motor	
• at 480 V rated value	0.2 A
at 400 V rated value at 600 V rated value	0.2 A
Short-circuit protection	V.2.7.
	Yes
product function short circuit protection	
design of the short-circuit trip	magnetic
Installation/ mounting/ dimensions	
mounting position	any
fastening method	screw and snap-on mounting onto 35 mm DIN rail according to DIN EN 60715
height	97 mm
width	45 mm
depth	97 mm
required spacing	
with side-by-side mounting at the side	0 mm
 for grounded parts at 400 V 	
— downwards	30 mm
— upwards	30 mm
— at the side	9 mm
• for live parts at 400 V	
— downwards	30 mm
— upwards	30 mm
— at the side	9 mm

- upwards - at the side - for live parts at 500 V - downwards - upwards - at the side - upwards - at the side - upwards - at the side - upwards - upwards - backwards - at the side - backwards - at the side - backwards - at the side - forwards - forwards - forwards - forwards - forwards - upwards - forwards - upwards - backwards - onm - at the side - forwards - upwards - backwards - onm - at the side - forwards - onm - at the side - forwards - backwards - b	CCC UL		TEXES.
- upwards		ENL	IECEX
- upwards	Confirmation (in)	KC EOF	IECEx
- upwards - at the side for live parts at 500 V - downwards - upwards - at the side - or many at the side - forwards Connectional Terminals type of electrical connection - for main current circuit arrangement of electrical connections - for main current circuit arrangement of electrical connections - for main contacts - solid or stranded - finely stranded with core end processing - x (10, x (1, x (1), x (1)	General Product Approval		For use in hazard- ous locations
- upwards - at the side - for live parts at 500 V - downwards - upwards - at the side - upwards - at the side - side - for grounded parts at 690 V - downwards - upwards - upwards - for grounded parts at 690 V - downwards - upwards - backwards - onm - upwards - onm - at the side - forwards - of live parts at 690 V - downwards - of live parts at 690 V - downwards - of live parts at 690 V - downwards - of live parts at 690 V - downwards - of live parts at 690 V - downwards - of live parts at 690 V - downwards - onm - on			
- upwards			
upwards			
- upwards		IP20	
- upwards - at the side • for live parts at 500 V - downwards - upwards - at the side • for grounded parts at 690 V - downwards - upwards - upwards - upwards - upwards - backwards - upwards - backwards - backwards - for live parts at 690 V - downwards - for live parts at 690 V - downwards - backwards - backwards - for live parts at 690 V - downwards - for live parts at 690 V - downwards - for live parts at 690 V - downwards - for live parts at 690 V - downwards - upwards - backwards - upwards - backwards - upwards - backwards - onm - forwards - onm - forwards - onm - onm - forwards - onm - forwards - onm - forwards - for main current circuit arrangement of electrical connections - for main contacts - solid or stranded - finely stranded with core end processing - for AWG cables for main contacts - for AWG cables for main contacts - tightening torque - for AWG cables for main contacts - tightening torque - for amin contacts with screw-type terminals - seld or stranded - seld or stranded - finely stranded with core end processing - for AWG cables for main contacts - seld or stranded - finely stranded with core end processing - for AWG cables for main contacts - seld or stranded - seld or stranded - finely stranded with core end processing - for AWG cables for main contacts - seld or stranded - finely stranded with core shaft - blameter 5 to 6 mm - size of the screwdriver shaft - blameter 5 to 6 mm - size of the thread of the connection screw - for main contacts - with high demand rate according to SN 31920 - with high demand rate according to SN 31920 - with high demand rate according to SN 31920 - with high demand rate according to SN 31920 - with high demand rate according to SN 31920 - with high demand rate according to SN 31920 - with high demand rate according to SN 31920 - with high demand rate according to SN 31920 - with high demand rate according to SN 31920 - with high demand rate according to SN 31920 - with high demand rate according to SN 31920 - with high demand rate according to SN 31920 - with hig	·	10 a	
- upwards - at the side • for live parts at 500 V - downwards - upwards - at the side • for grounded parts at 690 V - downwards - upwards - upwards - of grounded parts at 690 V - downwards - upwards - backwards - backwards - backwards - for ovards - for live parts at 690 V - downwards - for live parts at 690 V - downwards - for live parts at 690 V - downwards - for live parts at 690 V - downwards - for live parts at 690 V - downwards - upwards - backwards - upwards - backwards - upwards - backwards - backwards - omm - at the side - forwards - formain current circuit arrangement of electrical connection - for main current circuit arrangement of electrical connectors for main current circuit ype of connectable conductor cross-sections - for main contacts - solid or stranded - finely stranded with core end processing - for AWG cables for main contacts - solid or stranded - finely stranded with core end processing - for AWG cables for main contacts - solid or stranded - finely stranded with core end processing - for awg cables for main contacts - solid or stranded - finely stranded with core end processing - for stranded with core end processing - for awg cables for main contacts - solid or stranded - finely stranded with core end processing - for stranded with core end processing - for awg cables for main contacts - solid or stranded - finely stranded with core end processing - for awg cables for main contacts - solid or stranded - finely stranded with core end processing - for awg cables for main contacts - solid or stranded - finely stranded with core end processing - for awg cables for main contacts - solid or stranded - finely stranded with core end processing - solid or stranded - finely stranded with core end processing - solid or stranded - finely stranded - solid mit and the stranded - solid mit and the solid mit and th		50 FIT	
- upwards			
- upwards - at the side • for live parts at 500 V - downwards - at the side • for grounded parts at 690 V - downwards - at the side • for grounded parts at 690 V - downwards - backwards - backwards - backwards - backwards - forwards - forwards - forwards - formands - formands - at the side - side - forwards - backwards - formands - formands - the side - backwards - formands - the side - formands - formands - the side - formands - the side - formands - forman	-		
upwards		50 %	
- upwards - at the side • for live parts at 500 V - downwards - upwards - at the side • for grounded parts at 690 V - downwards - upwards - of grounded parts at 690 V - downwards - backwards - upwards - backwards - at the side - forwards - at the side - forwards - of live parts at 690 V - downwards - for live parts at 690 V - downwards - for live parts at 690 V - downwards - forwards - for live parts at 690 V - downwards - for live parts at 690 V - downwards - for live parts at 690 V - downwards - for live parts at 690 V - for main curent circuit - street live live live live live live live live		5 550	
- upwards - at the side 9 mm • for live parts at 500 V - downwards 30 mm 9 mm • for grounded parts at 690 V - downwards 50 mm • for grounded parts at 690 V - downwards 50 mm - upwards 50 mm - backwards 0 mm - the side 9 mm • for live parts at 690 V - downwards 50 mm - backwards 0 mm • for live parts at 690 V - downwards • for live parts at 690 V - downwards • for live parts at 690 V - downwards 0 mm • for live parts at 690 V - downwards 0 mm • for main current circuit arrangement of electrical connectors for main current circuit type of connectable conductor cross-sections • for main current circuit arrangement of electrical connectors for main current circuit type of connectable conductor cross-sections • for main contacts - solid or stranded - finely stranded with core end processing • for AWG cables for main contacts • for main contacts with screw-type terminals design of screwdriver shaft size of the screwdriver shaft Diameter 5 to 6 mm size of the screwdriver shaft Diameter 5 to 6 mm size of the screwdriver shaft Diameter 5 to 6 mm size of the screwdriver shaft Diameter 5 to 6 mm size of the screwdriver shaft Diameter 5 to 6 mm size of the screwdriver shaft Diameter 5 to 6 mm size of the screwdriver shaft Diameter 5 to 6 mm size of the screwdriver shaft Diameter 5 to 6 mm size of the screwdriver shaft Diameter 5 to 6 mm size of the screwdriver shaft Diameter 5 to 6 mm size of the screwdriver shaft Diameter 5 to 6 mm size of the screwdriver shaft Diameter 5 to 6 mm size of the screwdriver shaft Diameter 5 to 6 mm		5,000	
- upwards - at the side • for live parts at 500 V - downwards 30 mm - upwards 30 mm - at the side 9 mm • for grounded parts at 690 V - downwards 50 mm - upwards 50 mm - upwards 60 mm - backwards 0 mm - forwards 0 mm • for live parts at 690 V - downwards 50 mm - backwards 0 mm • for live parts at 690 V - downwards 50 mm • for live parts at 690 V - downwards 50 mm • for live parts at 690 V - downwards 50 mm • for live parts at 690 V - downwards 50 mm • packwards 0 mm - at the side 30 mm - packwards 0 mm - at the side 30 mm - packwards 0 mm - at the side 7 main current circuit type of electrical connection • for main current circuit type of connectable conductor cross-sections • for main contacts - solid or stranded - finely stranded with core end processing • for AWIC cables for main contacts • for main contacts with screw-type terminals design of screwdriver shaft size of the screwdriver shaft bize of the screwdriver in thread of the connection screw • for main contacts • for main contacts • for main contacts • for main contacts with screw-type terminals 0.8 1.2 N·m design of screwdriver shaft bize of the screwdriver shaft bize of the screwdriver in thread of the connection screw • for main contacts			
- upwards - at the side • for live parts at 500 V - downwards - upwards - upwards - at the side • for grounded parts at 690 V - downwards - upwards - upwards - upwards - upwards - downwards - upwards - upwards - upwards - upwards - backwards - upwards - backwards - o mm - for wards - for live parts at 690 V - downwards - for wards - o mm - forwards - for live parts at 690 V - downwards - o mm - for wards - o mm - for wards - upwards - o mm - for wards - upwards - backwards - upwards - backwards - upwards - backwards - o mm - for wards - o mm - the side - forwards - o mm - the side - forwards - o mm - the side - forwards - o mm - townections/Terminals type of electrical connection - for main current circuit arrangement of electrical connectors for main current circuit type of connectable conductor cross-sections - for main contacts - solid or stranded - finely stranded with core end processing - for AWG cables for main contacts - for MG cables for main contacts - for MG cables for main contacts - for AWG cables for main contacts - for AWG cables for main contacts - for main contacts with screw-type terminals - for AWG cables for main contacts - for main contacts with screw-type terminals - for AWG cables for main contacts - for main contacts with screw-type terminals - for AWG cables for main contacts - for main contacts with screw-type terminals - for AWG cables for main contacts - for main contacts with screw-type terminals - for AWG cables for main contacts - for main contacts with screw-type terminals - for AWG cables for main contacts - for main contacts with screw-type terminals - for AWG cables for main contacts - for main contacts with screw-type terminals - for AWG cables for main contacts - for main contacts with screw-type terminals - for AWG cables for main contacts - for main contacts with screw-type terminals - for for the screw-type terminals - for		M3	
- upwards - at the side • for live parts at 500 V - downwards - upwards - at the side • for grounded parts at 690 V - downwards - upwards - upwards - downwards - upwards - upwards - upwards - upwards - backwards - upwards - at the side - for grounded parts at 690 V - downwards - at the side - forwards - on mm - at the side - forwards - on mm - for live parts at 690 V - downwards - for live parts at 690 V - downwards - upwards - on mm - the side - on mm - backwards - upwards - on mm - backwards - upwards - on mm - backwards - on mm - backwards - on mm - on tat the side - forwards - on mm - forwards - on mm Connections/ Terminals type of electrical connection - for main current circuit arrangement of electrical connectors for main current circuit type of connectable conductor cross-sections - for main contacts - solid or stranded - finely stranded with core end processing - for AWG cables for main contacts - for main contacts - for main contacts - for AWG cables for main contacts - for main contacts with screw-type terminals - for all parts at 500 km - for main contacts - for AWG cables for main contacts - for MWG cables for main contacts - for main contacts with screw-type terminals - for Dameter 5 to 6 mm - for well at 500 km - for main contacts with screw-type terminals - for main contacts - for main contacts - for main contacts	-		
upwards	i	Pozidriv size 2	
upwards	design of screwdriver shaft	Diameter 5 to 6 mm	
- upwards - at the side 9 mm • for live parts at 500 V - downwards 30 mm - upwards 30 mm - at the side 9 mm • for grounded parts at 690 V - downwards 50 mm - upwards 50 mm - upwards 50 mm - backwards 0 mm - at the side 9 mm • for live parts at 690 V - downwards • for live parts at 690 V - downwards • for live parts at 690 V - downwards 0 mm • for live parts at 690 V - downwards 10 mm - at the side 10 mm - the side 10 mm - the side 10 mm - at the side 10 mm - forwards 10 mm Connections/ Terminals type of electrical connector • for main current circuit arrangement of electrical connectors for main current circuit type of connectable conductor cross-sections • for main contacts - solid or stranded - finely stranded with core end processing • for AWG cables for main contacts 2x (0.5 1.5 mm²), 2x 4 mm² 2x (0.75 2.5 mm²)		0.8 1.2 N·m	
- upwards	tightening torque		
- upwards 9 mm • for live parts at 500 V - downwards 30 mm - upwards 9 mm • for grounded parts at 690 V - downwards 50 mm • tor grounded parts at 690 V - downwards 50 mm - upwards 50 mm - upwards 50 mm - backwards 0 mm - at the side 30 mm • for live parts at 690 V - downwards 50 mm - at the side 30 mm • for live parts at 690 V - downwards 50 mm • for live parts at 690 V - downwards 50 mm - upwards 50 mm - upwards 50 mm - packwards 50 mm - upwards 50 mm - packwards 0 mm - packwards 0 mm - the side 30 mm - forwards 0 mm Connections/ Terminals type of electrical connection • for main current circuit screw-type terminals arrangement of electrical connectors for main current circuit type of connectable conductor cross-sections • for main contacts - solid or stranded 2x (0,75 2,5 mm²), 2x 4 mm²			
- upwards 30 mm - at the side 9 mm • for live parts at 500 V - downwards 30 mm - upwards 30 mm - at the side 9 mm • for grounded parts at 690 V - downwards 50 mm - upwards 50 mm - upwards 50 mm - upwards 50 mm - at the side 30 mm - at the side 30 mm - at the side 50 mm - forwards 0 mm - for live parts at 690 V - downwards 50 mm - at the side 30 mm - for live parts at 690 V - downwards 50 mm - upwards 50 mm - upwards 50 mm - upwards 50 mm - backwards 0 mm - at the side 30 mm - forwards 0 mm - forwards 0 mm Connections/ Terminals type of electrical connection • for main current circuit screw-type terminals arrangement of electrical connectors for main current circuit type of connectable conductor cross-sections • for main contacts			
- upwards 30 mm - at the side 9 mm • for live parts at 500 V - downwards 30 mm - upwards 30 mm - at the side 9 mm • for grounded parts at 690 V - downwards 50 mm - upwards 50 mm - upwards 50 mm - upwards 0 mm - at the side 30 mm - at the side 30 mm - forwards 0 mm • for live parts at 690 V - downwards 50 mm - the side 30 mm - forwards 0 mm • for live parts at 690 V - downwards 50 mm - upwards 50 mm - the side 30 mm - forwards 0 mm - the side 30 mm - backwards 0 mm - to rowards 0 mm - at the side 30 mm - forwards 0 mm - forwards 0 mm Connections/ Terminals type of electrical connectors for main current circuit arrangement of electrical connectors for main current circuit type of connectable conductor cross-sections		2x (0.75 2.5 mm²), 2x 4 mm²	
upwards 30 mm at the side 9 mm • for live parts at 500 V downwards 30 mm upwards 30 mm at the side 9 mm • for grounded parts at 690 V downwards 50 mm upwards 50 mm upwards 50 mm backwards 0 mm at the side 30 mm forwards 0 mm • for live parts at 690 V downwards 50 mm at the side 30 mm forwards 0 mm • for live parts at 690 V downwards 50 mm townwards 50 mm upwards 50 mm upwards 50 mm upwards 50 mm upwards 50 mm backwards 0 mm backwards 0 mm backwards 0 mm backwards 0 mm at the side 30 mm forwards 0 mm forwards 0 mm Connections/ Terminals type of electrical connection for main current circuit screw-type terminals arrangement of electrical connectors for main current Top and bottom			
- upwards - at the side			
- upwards 30 mm - at the side 9 mm • for live parts at 500 V - downwards 30 mm - upwards 30 mm - upwards 9 mm • for grounded parts at 690 V - downwards 50 mm - upwards 50 mm - upwards 0 mm - at the side 30 mm - at the side 30 mm - backwards 0 mm - at the side 30 mm • for live parts at 690 V - downwards 50 mm • for live parts at 690 V - downwards 50 mm - at the side 30 mm • for live parts at 690 V - downwards 50 mm - upwards 50 mm - upwards 50 mm - upwards 50 mm - upwards 50 mm - backwards 0 mm - backwards 0 mm - at the side 30 mm - forwards 0 mm - at the side 30 mm - forwards 0 mm Connections/ Terminals			
- upwards 30 mm - at the side 9 mm ● for live parts at 500 V - downwards 30 mm - upwards 30 mm - upwards 9 mm ● for grounded parts at 690 V - downwards 50 mm - upwards 50 mm - upwards 50 mm - backwards 0 mm - at the side 30 mm - forwards 0 mm ● for live parts at 690 V - downwards 50 mm - towards 0 mm ● for live parts at 690 V - downwards 50 mm - upwards 0 mm - at the side 30 mm - forwards 50 mm - upwards 50 mm - upwards 50 mm - upwards 50 mm - backwards 0 mm - backwards 0 mm - backwards 0 mm - at the side 30 mm - forwards 0 mm		screw-type terminals	
upwards 30 mm at the side 9 mm ■ for live parts at 500 V downwards 30 mm upwards 30 mm upwards 9 mm ■ at the side 9 mm ■ for grounded parts at 690 V downwards 50 mm upwards 50 mm backwards 0 mm at the side 30 mm forwards 0 mm ■ for live parts at 690 V downwards 50 mm towards 50 mm towards 50 mm forwards 50 mm forwards 50 mm forwards 50 mm downwards 50 mm upwards 50 mm upwards 50 mm backwards 50 mm at the side 30 mm at the side 30 mm forwards 0 mm			
upwards 30 mm at the side 9 mm ■ for live parts at 500 V downwards 30 mm upwards 30 mm at the side 9 mm ■ for grounded parts at 690 V downwards 50 mm upwards 50 mm backwards 0 mm forwards 30 mm ■ for live parts at 690 V downwards 50 mm the side 30 mm forwards 0 mm ■ for live parts at 690 V downwards 50 mm upwards 50 mm backwards 50 mm backwards 0 mm at the side 30 mm		V tidil	
— upwards 30 mm — at the side 9 mm ● for live parts at 500 V 30 mm — downwards 30 mm — upwards 9 mm ● for grounded parts at 690 V 50 mm — downwards 50 mm — backwards 0 mm — at the side 30 mm — forwards 0 mm ● for live parts at 690 V 50 mm — downwards 50 mm — upwards 50 mm — backwards 0 mm			
upwards 30 mm at the side 9 mm ■ for live parts at 500 V downwards 30 mm upwards 30 mm upwards 9 mm ■ for grounded parts at 690 V downwards 50 mm upwards 50 mm upwards 0 mm backwards 0 mm at the side 30 mm forwards 0 mm ■ for live parts at 690 V downwards 50 mm forwards 50 mm forwards 50 mm forwards 50 mm			
upwards 30 mm at the side 9 mm ■ for live parts at 500 V downwards 30 mm upwards 30 mm upwards 30 mm at the side 9 mm ■ for grounded parts at 690 V downwards 50 mm upwards 50 mm upwards 50 mm backwards 0 mm at the side 30 mm forwards 0 mm ■ for live parts at 690 V downwards 50 mm	·		
 — upwards — at the side			
— upwards 30 mm — at the side 9 mm ● for live parts at 500 V 30 mm — downwards 30 mm — upwards 9 mm ● for grounded parts at 690 V 9 mm — downwards 50 mm — upwards 50 mm — backwards 0 mm — at the side 30 mm	• for live parts at 690 V		
— upwards 30 mm — at the side 9 mm ● for live parts at 500 V 30 mm — downwards 30 mm — upwards 9 mm ● for grounded parts at 690 V 50 mm — downwards 50 mm — upwards 50 mm — backwards 0 mm	— forwards	0 mm	
— upwards 30 mm — at the side 9 mm ● for live parts at 500 V 30 mm — downwards 30 mm — upwards 30 mm — at the side 9 mm ● for grounded parts at 690 V 50 mm — downwards 50 mm — upwards 50 mm			
 — upwards — at the side	·	0 mm	
 — upwards — at the side 9 mm • for live parts at 500 V — downwards — upwards — upwards — at the side • for grounded parts at 690 V 30 mm — 30 mm —			
 — upwards — at the side 9 mm • for live parts at 500 V — downwards — upwards — at the side 30 mm 30 mm 9 mm 		50 mm	
 — upwards — at the side 9 mm • for live parts at 500 V — downwards — upwards 30 mm 30 mm 30 mm 		9 111111	
 — upwards — at the side • for live parts at 500 V — downwards 30 mm 9 mm 30 mm 	•		
 — upwards — at the side • for live parts at 500 V 30 mm 9 mm			
— upwards 30 mm	·		
	— at the side	9 mm	
downwards 50 min	— upwards	30 mm	
— downwards 30 mm		30 111111	
• for grounded parts at 500 V	— downwards	20 mm	







Type Test Certificates/Test Report

Special Test Certificate



Marine / Shipping

other











Confirmation

other

Railway



Confirmation

Vibration and Shock

Further information

Siemens has decided to exit the Russian market (see here).

https://press.siemens.com/global/en/pressrelease/siemens-wind-down-russian-business

Siemens is working on the renewal of the current EAC certificates.

Please contact your local Siemens office on the status of validity of the EAC certification if you intend to import or offer to supply these products to an EAC relevant market (other than the sanctioned EAEU member states Russia or Belarus).

Information on the packaging

https://support.industry.siemens.com/cs/ww/en/view/109813875

Information- and Downloadcenter (Catalogs, Brochures,...)

https://www.siemens.com/ic10

Industry Mall (Online ordering system)

https://mall.industry.siemens.com/mall/en/en/Catalog/product?mlfb=3RV2011-0BA10

Cax online generator

http://support.automation.siemens.com/WW/CAXorder/default.aspx?lang=en&mlfb=3RV2011-0BA10

Service&Support (Manuals, Certificates, Characteristics, FAQs,...)

https://support.industry.siemens.com/cs/ww/en/ps/3RV2011-0BA10


Image database (product images, 2D dimension drawings, 3D models, device circuit diagrams, EPLAN macros, ...)


http://www.automation.siemens.com/bilddb/cax_de.aspx?mlfb=3RV2011-0BA10&lang=en


Characteristic: Tripping characteristics, I2t, Let-through current


https://support.industry.siemens.com/cs/ww/en/ps/3RV2011-0BA10/char

Further characteristics (e.g. electrical endurance, switching frequency)
http://www.automation.siemens.com/bilddb/index.aspx?view=Search&mlfb=3RV2011-0BA10&objecttype=14&gridview=view1

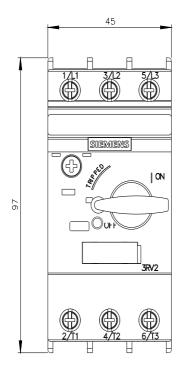

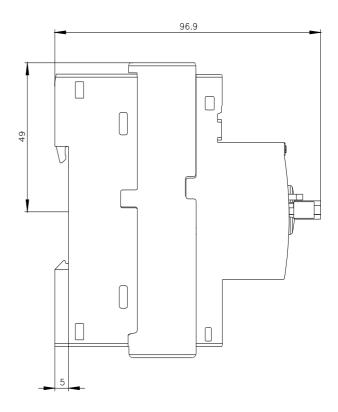

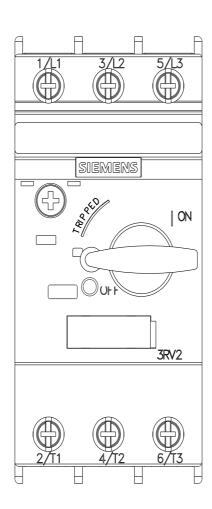

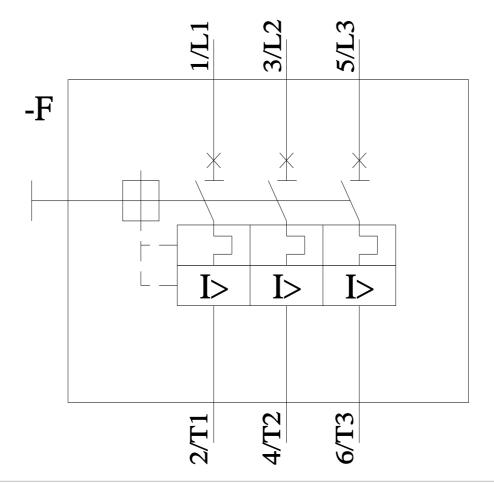

last modified: 11/21/2022 🖸